| MACHINE | SERIAL No. | |
|---------|------------|---------|
| 623G | DBC00412 | Tractor |
| | DBY00412 | Trailer |

Service History

| DATE | HOURS | FAULT | FIX | FIXED BY |
|-----------|-------|---|--|-------------------|
| 21/6/22 | 9185 | Cutting edges | Remove rotate and refit router bits. Remove and replace outer cutting edges. | MLDiesel Services |
| 25/6/22 | 9199 | Centre edge | Replace centre edge with new | MLDiesel Services |
| 29/6/22 | | Pos 3 Trailer tyre puncture | Fitted 2 x New Bridgestone 33.25R29 Traction V-steel tyres to POS.1/2 (55psi). Fitted 2nd hand front tyres to POS.3/4 approx. 50% tyres (60psi). Added Rim conditioner to each tyreOld tyres NWR | Giant Tyres |
| 12/7/22 | 9316 | Warning light | Diagnosed data link fault. Found loom rubbed thru below cab. Repair required. | MLDiesel Services |
| 15/7/2022 | 9336 | Warning light | Test and inspect data link circuit and inspect/clean all wiring connectors. Remove and replace primary transmission output speed sensor and sensor wiring harness to transmission ECM. | MLDiesel Services |
| 15/7/22 | 9336 | Cutting edges | Replace centre edge and rotate outer edges. | MLDiesel Services |
| 17/8/22 | | Data Link Cable fault | Fabricate and fit new data link harness between engine, transmission and monitor ECM's. Replace harness connectors and pins as required. | MLDiesel Services |
| 22/8/22 | | Fuel head/retyurn lines. Turbo hose/ s. | Replace fuel filter head to hitch return hose with new. Replace turbo return coolant hose with new. Replace turbo outlet silicone hump hose with new. Top up coolant. | MLDiesel Services |

| DATE | HOURS | FAULT | FIX | FIXED BY |
|------------|-------|--|--|------------------------------------|
| 7/9/22 | 9618 | Cutting edges | Replace all cutting edges and router bits with new. Replace all mounting hardware with new. | MLDiesel Services |
| 7/9/22 | 9618 | 250 hour service | Carry out 250 hour service as per operation and service manual. Fit all customer supplied filters and general inspection of machine. SOS oil samples. | |
| 12/9/22 | 9637 | Cutting edges | Rotate centre cutting edge. Fit new router bits. | MLDiesel Services |
| 10/10/22 | 9770 | Engine not starting | Test machine batteries and power supplies - all ok. Test operation of key barrel and starter motor, found starter motor failed. Remove and install starter motor with new. | MLDiesel Services |
| 18/10/2022 | | Elevator flights too close to cutting edge | Adjust elevator frame up using spacer blocks | MLDiesel Services |
| 26/10/2022 | | Broken exhaust tip | New exhaust ejector pipe fitted | MLDiesel Services |
| | | Horn button missing | New horn button as. Fitted to steering wheel | MLDiesel Services |
| 1/11/22 | | Tyre Pressures | Inflated POS.1/2 to 70psi | MLDiesel Services |
| 9/11/22 | | Loss of elevator control | Test machine for active faults. Logged codes for control lever in cab. Remove and replace control lever with new, calibrate lever and tested ok. | MLDiesel Services |
| 21/11/2022 | 9986 | Collapsed carrier roller bearings | New LH side Roller as. Elevator carrier roller 4468013 fitted | Dale Wescombe |
| 28/11/2022 | 10036 | 2000 Hr Service | Carry out 2000hr service as per operation and service manual. General inspection of machine and its operation. | MLDiesel Services |
| 28/11/22 | 10036 | 2x Bent and cracked elevator flights | Change 2 x elevator flights with 2nd hand ones. Used original hardware | MLDiesel services Dale Wescombe |
| 28/11/22 | 10036 | Precaution | New RH side carrier roller fitted. 4468013 | MLDiesel Services |

| DATE | HOURS | FAULT | FIX | FIXED BY |
|-----------|-------|------------------------------------|---|--|
| 6/1/23 | 10274 | 250 hour service | Engine oil and filter replaced | Dale Wescombe |
| 6/1/23 | 10274 | Broken grease line on RH H-link | Grease Line blocked. Temporary fix by installing grease nipples to pin | Dale Wescombe |
| 24/2/2023 | 10656 | A/C Fault | Tested ac for no airflow. Dismantle HVAC unit and inspect operation of blower assembly. Blower motors failed. Replaced fan motors with new. Clean evaporator core and reassemble HVAC unit. | MLDiesel Services |
| 6/3/23 | 10718 | Elevators | Fitted New Cat sprockets, New ITR chains and 2 x new ITR flights to elevators | Diesel Mech |
| 27/3/23 | 10886 | Fuel Lines | Fitted all new fuel delivery lines and return lines around engine. | MLDiesel services Dale Wescombe |
| 27/3/23 | 10886 | Sensor | Found fault with air intake pressure sensor. Replaced with new. | MLDiesel Services |
| 13/4/23 | 11012 | 250 hour service | Replaced engine oil and filter. Replaced fuel/water filters. Replaced inner/outer air filters. | Dale Wescombe |
| 13/4/23 | 11012 | Air leak | Air leak from tractor parking brake dump valve. Replaced with new. | MLDiesel Services |
| 3/5/23 | 11170 | Scraper floor rollers | Replaced front floor rollers with new | Dale Wescombe |
| 3/5/23 | 11170 | Cutting edges | Replaced centre and outer cutting edges with new. | Dale Wescombe |
| 15/5/23 | 11262 | 250 hour service | Engine oil and filter replaced | Dale Wescombe Blake Wescombe |
| 24/5/23 | 11338 | Cutting edges | Turned centre edge | Dale Wescombe |
| 16/6/23 | 11516 | 250 hour service | Engine oil and filter replaced | Dale Wescombe Karl tate Blake Wescombe |
| 16/6/2023 | 11516 | Cutting edges | Replaced centre edge with new Tungsten armoured edge | Dale Wescombe Karl tate Blake Wescombe |
| 22/7/2023 | 11792 | 250 hour service | Engine oil and filter replaced | Dale Wescombe |

| DATE | HOURS | FAULT | FIX | FIXED BY |
|------------|-------|--|--|--|
| 14/8/23 | 11970 | Bowl lift cylinders weeping | Remove both lift cylinders from bowl. Had to lance mounting pins out. Reassemble both cylinders with new rods and seals. Refit cylinders with new mounting pins and hardware. | MLDiesel Services |
| 14/8/2023 | 12010 | 1000 hour service | Engine oil and filter. Fuel filter and water separator filters changed. Air filter inner/outer changed. Transmission oil and filters changed. | Dale Wescombe Karl tate Blake Wescombe |
| 12/9/23 | 12204 | Harsh ride | Found excessive wear in cushion hitch horizontal pins and bearing causing harsh ride. Found burst grease line and repaired. | MLDiesel Services |
| 13/10/23 | 12458 | Cushion Hitch rebuild | Split tractor and scraper. Disassembled all components on cushion hitch area. Line bored various bearing mounts around hitch, as required. Reassembled cushion hitch with all new bearings and pins. Rebuilt cushion hitch hydraulic ram. Reassembled machine. | MLDiesel services Dale Wescombe |
| 17/11/2023 | 12322 | 250 hour service | Engine oil and filter replaced | Dale Wescombe Karl tate Blake Wescombe |
| 17/11/2023 | 12322 | GET Stinger, Outer edges and Routers | Replaced Stinger and Outer cutting edges with Tungsten armour. Fitted new un-armoured Routers | Dale Wescombe Karl tate Blake Wescombe |
| 20/11/2023 | 12342 | RH Ejector wall roller missing | Replaced LH with New Roller. Replaced RH with 2nd hand hat only | Dale Wescombe |
| 22/11/2023 | 12371 | GET centre edge | Flipped to New Tungsten Armoured side | Dale Wescombe |
| 27/11/2023 | 12423 | Engine oil low | e oil low 5 litres added | |
| 2/12/23 | | LED Lights | Lights Fit Black tips LED lighting to from of scraper | |
| 14/12/2023 | 12643 | RH low beam headlight out | Replaced H3 globe | Dale Wescombe |
| 18/12/2023 | 12684 | RH mirror U/S | Replaced with new mirror and mounts | Dale Wescombe |

| DATE | HOURS | FAULT | FIX | FIXED BY |
|------------|-------|--|---|-------------------|
| 19/12/2023 | 12700 | LH Ejector wall floor roller collapsed | Replaced with new ITR greasable roller. Checked RH floor roller OK | Dale Wescombe |
| 20/12/2023 | 12716 | GET centre edge | Replaced stinger with un-armoured edge | Dale Wescombe |
| 20/12/2023 | 12716 | Engine oil low | 5 litres added | Dale Wescombe |
| 20/12/2023 | 12716 | Oil leak | Labour - Hourly Rate, 20/12/2023; Travel to Little river site, Inspect 623g scraper for cause of oil leak. Remove center machine belly guard, Found retarder oil supply and return hose to be brittle and leaking, New required. Remove and replace leaking retarder hoses with new. Check fluid levels and assist with refitment of center cutting edge. Total 4.5hrs | MLDiesel Services |
| 8/1/2024 | 12796 | 250 hour service | Engine oil and filter replaced | Dale Wescombe |
| 5/2/24 | 13085 | 1000 hour service | Carry out 1000 hour service as per operation and maintenance manual. General inspection off machine and its operation | MLDiesel Services |
| 5/2/24 | 13085 | POS 3 Brake actuator | Remove and replace pos 3 brake actuator with new. Replace scraper park brake circuit air quick dump valve with new. Test operation. All ok | MLDiesel Services |
| 5/2/24 | 13085 | Floor rollers | Replace floor rollers 4x right and 2x Left | MLDiesel Services |
| 23/3/2024 | 13287 | 250 hour service | Engine oil and filter replaced | Dale Wescombe |
| 11/3/2024 | 13361 | Stinger needs changing | Changed stinger with chock block type | Dale Wescombe |
| 11/3/2024 | 13361 | Elevator centre roller missing | replaced both centre rollers with new ITR rollers | Dale Wescombe |

| DATE | HOURS | FAULT | FIX | FIXED BY |
|-----------|-------|--|--|--|
| 19/3/2024 | 13460 | Stinger needs changing | Replaced stinger with un-armoured edge | Dale Wescombe Blake Wescombe |
| 22/3/24 | 13518 | 250 hour service | Replaced engine oil and filter. Replaced fuel filter only. Replaced outer air filter. Inspected inner ok. | Dale Wescombe Blake Wescombe |
| 22/3/24 | 13518 | Stinger worn | Replaced stinger with ITR tungsten edge | Dale Wescombe Blake Wescombe |
| 4/4/24 | | Elevator chains | Retension adjust elevator chains | Diesel Mech |
| 18/4/2024 | 13647 | Stinger needs changing | Replaced stinger with tungsten armoured edge from Wear Life Engineering | Dale Wescombe Karl tate |
| 22/4/2024 | 13686 | Operator reported audible 'ticking' coming from engine | Cylinder 6 and 5 injector rocker arm rollers and camshaft lobes found to be eroding hard facing. Found cylinder 1 and 2 broken hold down bolts and removed. New Cat parts fitted. -Remove and fit new camshaft -Remove and fit all rocker arms -Remove and fit all hold down boltsRefit radiator Set valve clearances Fit inter cooling pipes Fit new coolant hoses Fit bonnet and belly plates. | ML Diesel Services Diesel Mech |
| 22/4/2024 | 13686 | 250 hour service | Replaced engine oil and filter | Diesel Mech |
| 29/4/2024 | 13766 | Flight cracked | Replaced flight | Dale Wescombe |
| 1/5/24 | 13785 | Pulley failure on alternator air con group | Replaced all pulleys, adjuster and belt with new | Dale Wescombe |
| 9/5/2024 | 13849 | Horn stuck on | Replaced horn button assembly. Horn stays stuck on. Removed steering wheel and cleaned up contact ring with emery paper. Reassembled and tested ok. | Diesel Mech |
| 22/5/2024 | 14008 | Floor roller brackets at front broke off | Welded them back up and refitted | Dale Wescombe Karl Tate. Marshall Eng. |

| DATE | HOURS | FAULT | FIX | FIXED BY |
|------------|-------|---|---|------------------------------------|
| 24/5/2024 | 14016 | LH ejector wall roller missing | Replaced LH with New Roller | Dale Wescombe Blake Wescombe |
| 31/5/2024 | 14016 | 2000 hr Service | Oil changed in all compartments, filters and SOS oil samples taken | Dale Wescombe DieselMech_Coen |
| 31/5/2024 | 14026 | Bowl skin getting thin in parts | Re-skinned LH/RH walls with 5mm 400 Hardox plate, Welded up cracks above routers and gusseted with plate and welded on hard facing to protect. Welded up hair line cracks in rear ejector wall floor roller mounts. Welded up hair line cracks in corners of bowl cross member. Welded in new sections of floor roller wear strips to suit. | Kwikweld_Casey Wooler |
| 21/6/2024 | 14026 | RH rear brake booster leaking | Replaced with rebuilt brake booster by MLDiesel services | Dale Wescombe |
| 21/6/2024 | 14026 | Elevator chains and rollers U/S | Replaced elevator chains with Caterpillar new chains. Replaced all hardware, sprockets, carrier rollers and bottom idlers with ITR new items | MLDiesel services Dale Wescombe |
| 25/6/2024 | 14026 | Ejector wall rollers milling into mount | Disassembled ejector wall and moved forward. Remove old rollers. Weld and square up mounting faces. Weld new wear strips into roller channel and square up. | Dale Wescombe Blake Wescombe |
| 20/8/2024 | 14126 | Crack in top of hydraulic tank | Cracked on 2 corners of mirror mount to hydraulic tank. Gouged out and re-welded mirror mount. Welded flat plate between mirror mount and Hydraulic filter housing to brace mirror mount/stop flexing. | Diesel Mech Dale Wescombe |
| 21/08/2024 | 14108 | Collapsed LH Elevator carrier roller | Replaced with new Cat carrier | Dale Wescombe Blake Wescombe |
| 21/8/24 | 14108 | RH/Rear ejector wall roller spinning in housing again. | Removed old washer. Tried to remove key from keyway but no success. Forced a galvanised washer into other side of roller shaft/mount jamming key into mount. Replaced locking washer with a new one and tightened up lock nut and bent over washer/keeper | Dale Wescombe Blake Wescombe |
| 21/8/24 | 14108 | Rear access step LH rubber broken | Removed broken belt. Cleaned up bolts. Replaced with new Cat part | Dale Wescombe Blake Wescombe |

| DATE | HOURS | FAULT | FIX | FIXED BY |
|------------|-------|---------------------|--|--|
| 10/9/24 | 14211 | Scraper won't start | Cleaned all terminals and mountings. Cleaned floor of battery box of dirt build up. Sprayed battery box with anti rust spray coat. Replaced all batteries with new Caterpillar Batteries. Started ok | Dale Wescombe Karl tate Blake Wescombe |
| 14/11/2024 | 14254 | 250 hour service | Replaced engine oil and filter. | Dale Wescombe |
| 9/2/2025 | 14287 | E-Stop Button | Wired up and fitted new E-Stop button in cab | Fabs Auto Electrical |

Time Sheet

25/10/2020

| TIME | SUNDAY | MONDAY | TUESDAY | WEDNESDAY | THURSDAY | FRIDAY | SATURDAY |
|------|--------|--------|---------|-----------|----------|--------|----------|
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |